

176

APPLICATION No.: 7349 $\frac{1}{2}$ " H leadTAP CLEARED 

LOCATION: R 178 Blackmer is numbered 176

DATE

BEF.

AFT.

REMARKS 

OWNER: Julio Viera

6/2/67

Reamed

MEASURES: $\frac{1}{2}$ "

H lead

Sept. 1, 1891

E from

Acushnet Ave.

122.7 ft.

N from S line

Blackmer

7.1 ft.

W from E line

House

1.6 ft.

June 2, 1967 Renewed from main to property line.
 16 ft. - $\frac{3}{4}$ " copper; 1- fig. 413; 1 wipe joint;
 1 - $\frac{3}{4}$ " Mueller curb stop; Tap reamed.

6/8/87: Owner dug property----Renewed from prop line
 to 3ft. inside prop. Stock: 3ft. $\frac{3}{4}$ " copper tubing
 1 - $\frac{3}{4}$ " cop to cop compression 1 - $\frac{3}{4}$ x $\frac{5}{8}$ lead to
 copper adapt. xxs ===== COPPER WAS NOT TO LINE. =====

12.18.2018 - Lead Service Line Replacement Program
 Contractor P. Gioioso and Sons

Type: CU, Diameter (in) 1, Water Pressure (PSI) 100

Distance curb stop to meter (ft) 80, Distance from main to

curb stop (ft) N/A, Distance from curb face to curb stop

(ft) 2.2, Total length of new pipe installed (ft) 80

Curb stop replace: No, Corporation replaced: no, ball valve
 furnished: Yes size 1"

Depth of service (ft) 4.5

