

R-004B_TIDE

COVE RD
New Bedford

Inspection Status: Remote Inspection
Inspection Level: Level 2

	Quick	Index	Rating
Overall	1C00	1	20
Structural	1700	1	7
O&M	1A00	1	13

Project: | New Bedford 3D Regulator Inspections
Owner: | New Bedford, MA
Customer: CCDM Smith

MANHOLE

MH Use: | Sanitary
Access Type: Manhole
Year Constructed:
Year Renewed:
Evidence of Surcharge: No

MEASUREMENTS

Rim to Invert: 10.5ft
Rim to Grade:
Grade to Invert: 10.5ft
Rim to Grade Exposed:
Northing:
Easting:
Elevation:
Vertical Datum:
GPS Accuracy:
Additional Information:

COVER

Type: Solid
Shape: Circular
Size: 24"
Size Width:
Center Cover Size:
Cover Material: Cast Iron
Hole Diameter:
Hole Number:
Bearing Surface Diameter: 26"
Bearing Surface Width: 1"
Cover/Frame Fit: Good
Cover Condition: Sound

COVER INSERT

Insert Type: None
Insert Condition:

COVER ADJUSTMENT RING

Ring Type: Solid
Ring Material: Cast Iron
Ring Condition: Sound
Ring Height:

FRAME

Frame Material: Cast Iron
Bearing Surface Width: 1"
Bearing Surface Depth: 9"
Clear Opening Diameter: 22"
Clear Opening Width: 22"
Frame Depth:
Offset Distance:
Seal Condition: Sound
Seal Inflow: None
Frame Condition: Sound

CHIMNEY

Chimney Present: Yes

Chimney Depth: 2.6ft

Clear Opening:

Chimney I/I:

First Material: Concrete (precast)

Second Material:

Lining Interior:

Lining Exterior:

Chimney Condition:

CONE

Cone Depth:

Cone Type: Not Present

Clear Opening:

First Material:

Second Material:

Lining Interior:

Lining Exterior:

Cone Condition:

WALL

Wall Diameter:

Wall Width:

Wall Depth: 6.7ft

First Material: Concrete (precast)

Second Material:

Lining Interior:

Lining Exterior:

Wall Condition:

BENCH

Bench Present: Yes

Material: Concrete (precast)

Lining:

Bench Condition:

CHANNEL

Channel Present: No

Material:

Type:

Exposure:

Channel Condition:

STEP

Number: 4

Material: Metal

PIPE CONNECTION INFORMATION

Pipe No.	Clock	Rim to Inv.	Direction	Material	Shape	Height	Width	Cond.	Seal Cond.	Pipe Type	Struct. ID	Comments
1	6	9"	Out	Brick	Circular	49"		Sound	Sound	Gravity Connection		
2	12	7.1"	In	Concrete Pipe (non-reinforced)	Rectangular	20"	47"	Sound	Sound	Gravity Connection		

GENERAL INFORMATION

Surveyed By:

Reviewed By: M. Bierman

Weather: Dry - No precipitation during survey

Purpose of Survey: Routine assessment

Certificate Number: U0219070304856

Reviewer Number: P0035145122021

Precleaning: No Pre-Cleaning

PO Number:

Media Label:

Date & Time 2023-12-13


Sheet No.:

Date Cleaned:

Work Order:

Consequence of Failure:

Condition Report

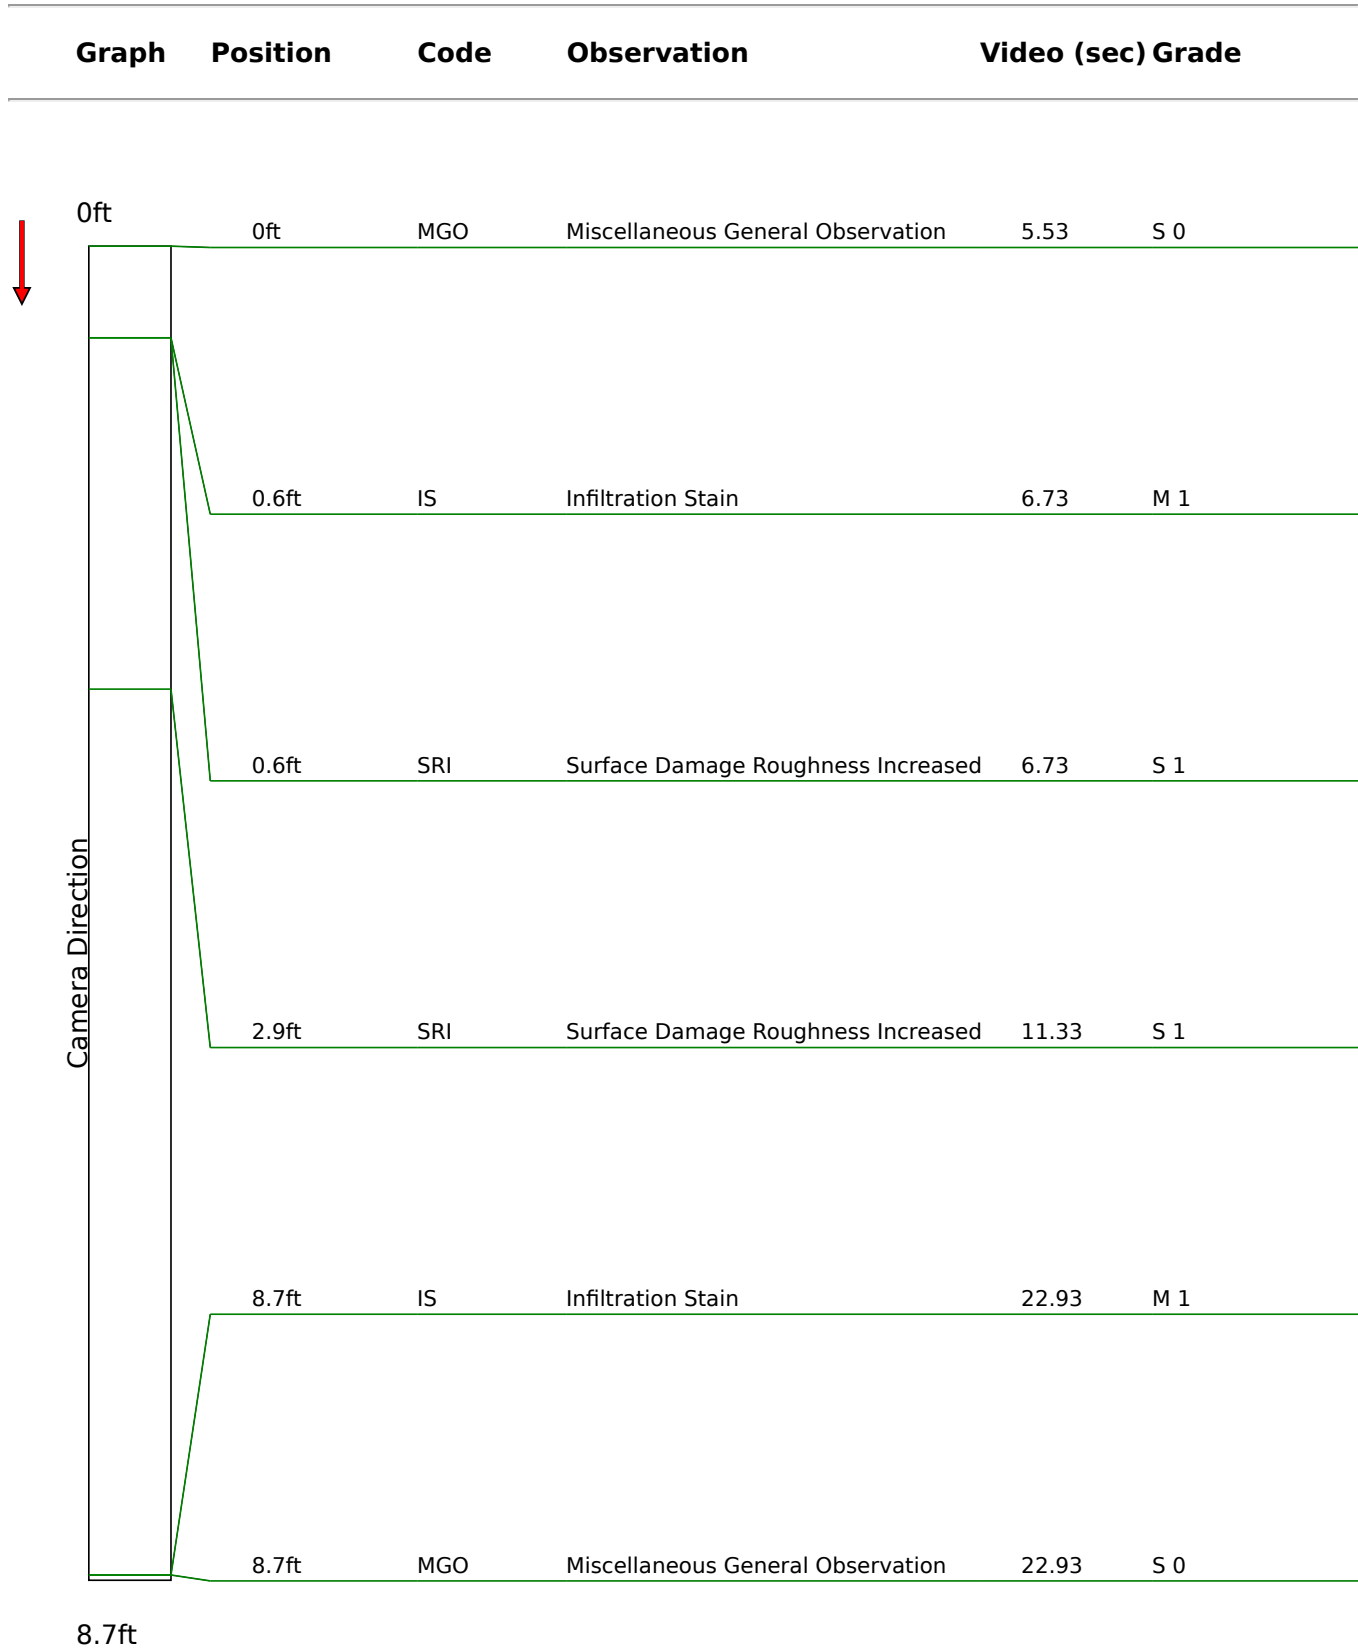



Code: **MGO**
Description: **Miscellaneous General Observation**

Distance: **0ft**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within Eight" of Joint: **False**
Remarks: **Start inspection**



Code: **IS**
Description: **Infiltration Stain**

Distance: **0ft**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **S01**
Within Eight" of Joint: **False**
Remarks:



Code: **SRI**
Description: **Surface Damage Roughness Increased**

Distance: **0ft**
Structural Grade: **1**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **S02**
Within Eight" of Joint: **False**
Remarks:



Code: **SRI**
Description: **Surface Damage
Roughness Increased**

Distance: **2ft**
Structural Grade: **1**
O&M Grade: **0**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **F02**
Within Eight" of Joint: **False**
Remarks:



Code: **IS**
Description: **Infiltration Stain**

Distance: **8ft**
Structural Grade: **0**
O&M Grade: **1**
Clock Start/From: **12**
Clock To: **12**
1st Value:
2nd Value:
Value Percent:
Continuous Index: **F01**
Within Eight" of Joint: **False**
Remarks:



Code: **MGO**
Description: **Miscellaneous General
Observation**

Distance: **8ft**
Structural Grade: **0**
O&M Grade: **0**
Clock Start/From:
Clock To:
1st Value:
2nd Value:
Value Percent:
Continuous Index:
Within Eight" of Joint: **False**
Remarks: **End inspection**

