

APPLICATION/AGREEMENT
For Trench/Disturbance Permit within the City of New Bedford

Permit # 545-2022
Dig Safe# 20224708101
Date: 11/25/2022

TO THE MAYOR AND CITY COUNCIL: DISTURBANCE PERMIT/TRENCH SAFETY PERMIT

Permission is hereby requested to excavate the surface of: X City Property and/or X Private Property
Provide Sketch

Location of Work: 35 Butler St.
E. Rodney French Blvd. - ~~Milbury St.~~
*Emergency Gas Maintenance

Work will begin (weather permitting) on: November 4, 2022

Applicant Name: Steven Botelho (ra) Excavator(s) Name: _____

Company Name: Eversource Hoisting Equipment License Number: _____
Grade: _____ Expiration Date: _____

Contact Number: 508-441-5817 Name & Contact Number of Insurer: _____

Competent Person on Work Site: ON FILE

APPROVED BY: Stephen Cupina DATE: 12-6-2022
TITLE: Asst. City Engineer

This permit shall be posted at the work site, and shall remain until the work is completed. It is subject to inspection at all times.

Trenches must be maintained
weekly until final paving is
completed

Work completed prior to D.P.L. approval under
emergency work order for Class II Leak

ROADWAY CLOSURES WILL REQUIRE
AUTHORIZATION FROM THE
COMMISSIONER OF PUBLIC
INFRASTRUCTURE. TRAFFIC MANAGEMENT
PLANS MAY BE REQUIRED.

Permit only valid for three months
from date of approval

DigSafe/ CBYD Number		PERMIT#		PROJECT#	GAS-EMGGAS2Y	Unique ID :	11270459-10-[OF86]
ADDRESS:	35 BUTLER ST	TOWN:	NEW BEDFORD	DATE:	11/25/22	WORK ORDER- TASK:	11270459-10
SHEET 1 of 3		LEAK REPORT #		LEAK CLASS		TYPE OF WORK:	GASMAINTENANCE
		Contractor:		WAMFWO:	30479436	WAMCTE #	996804

PIPE RETIREMENT

FACILITY_TYPE	MATERIAL	SIZE	LENGTH	PRESSURE	VIN YR
	Bare Steel	1-1/4	41	LP	1901

PIPE INSPECTION

No

PIPE INSTALL

FACILITY TYPE	MATERIAL	SIZE	LENGTH	PRESSURE	METHOD	OVERALL PIPE LENGTH	INSTALLED/ REPLACED	DEPTH OF COVER	CONNECTION AT MAIN	EFV INSTALLED	EFV SUBTYPE	EFV COMMENTS
Service	Plastic	1"	50'	LP	Insert	60' or Less	Full Service	2' 0"	Mechanical Saddle	No		

PRESSURE TEST

MEDIUM	TYPE	START TIME	START PRESSURE(PSIG)	FINISH TIME	FINISH PRESSURE(PSIG)	TEST DURATION	PERFORMED BY	SOAP TESTED	NOTES
Air	Service below 200 ft	2022-11-25 14:24:00	100	2022-11-25 14:43:00	100	19min	Jason arruda	Yes	At all connections

RESTORATION

CONSTRUCTION MATERIAL	LOCATION	EXISTING SURFACE FINISH	EXISTING DEPTH	LENGTH	WIDTH	REQUIRED DEPTH	TEMPORARY REPAIR ACTION	COMPACTION METHOD	% COMPACTED
Hot Asphalt	Street	Asphalt	4	6' 0"	5' 0"	4"		Compacted per O&M Standards	100
Dirt	Private Property	Grass		10' 0"	3' 0"				

MATERIALS

No

DESCRIPTION OF WORK COMPLETED

Installed 50 feet of 1 inch plastic from house to main... Inserted a portion of service from just after valve to private property... Used same taphole

PERSONNEL


FOREMAN / WORKING LEADER / INSPECTOR

SIGNATURE:

DigSafe/ C/BD Number		PERMIT#		PROJECT#	GAS-EMGGAS2Y	Unique ID :	11270459-10- [OF86]
ADDRESS:	35 BUTLER ST	TOWN:	NEW BEDFORD	DATE:	11/25/22	WORK ORDER- TASK:	11270459-10
URL:	http://CWV-CLKSOPRD1/Repository/ClickMobile/2022/cdv_photo_001_072648(XaylaDib).jpg	LEAK REPORT #		LEAK CLASS		TYPE OF WORK:	GASMAINTENANCE
SHEET 2 of 3		Contractor:		WAMFWO:	30479436	WAMCTE #	996804

7:20 PM Tue Nov 29

VPN 96%

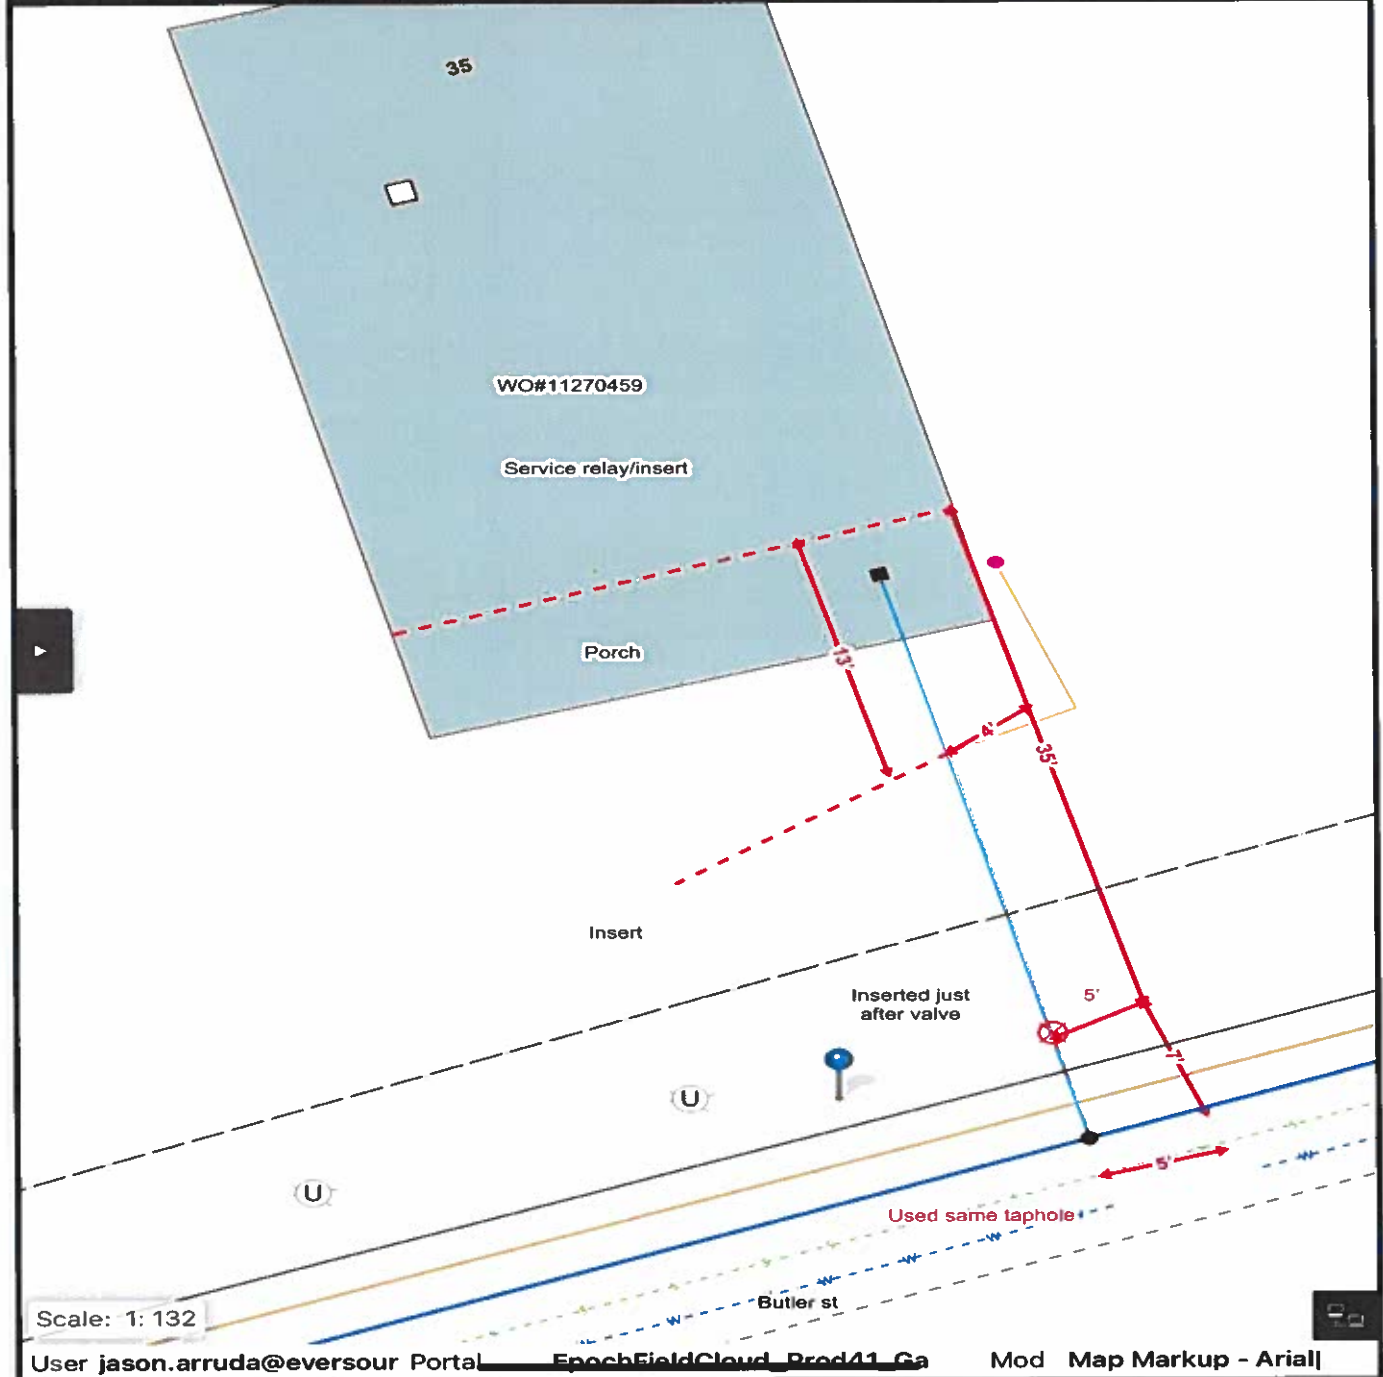

No Data Available

PERMITS

No Data Available

OTHER ATTACHMENTS

No Data Available