

APPLICATION No.: 15311

LOCATION: 390 Rockdale Avenue

OWNER: \_\_\_\_\_

31-313

MEASURES:

TAP CLEARED

DATE

BEF.

AFT.

REMARKS

08/29/22: JLC CONSTRUCTION RENEWED WATER SERVICE FROM CURB STOP TO METER,

SERVICE SIZE: ¾" copper:

S x S Line Westbrook St 117.9'

W x E line Rockdale Ave 5.8'

S x N line House 9.0'

N x S Line house 5.0'

W x W LINE HOUSE 18.8'

MAIN TO PROPERTY LINE 60.0'

PIPE INSIDE PROPERTY 13.0'

[illegible][illegible]



APPLICATION No.: 15311

TAP CLEARED

LOCATION: 390 Rockdale Ave.

OWNER: Joseph Jacintho

(INACTIVE SER)

DATE

BEF.

AFT.

REMARKS

3-17-83

Reamed

MEASURES: 5/8"

Lead

S x S line Westbrook St. 118.2 ft.  
 W x E line Rockdale Ave. 5.3 ft.  
 N x S line house 4.8 ft.  
 S x S line stone pillar cem. wall 10.7 ft.

March 17, 1983 Renewed from the main to a point 21 ft. ea  
 of main.

Installed a 3/4" curb stop at this point (buried).

21 ft. - 3/4" copper tubing 3/4" curb stop

1 - 5/8" x 3/4" lead to copper adapt. XXS  
 ( 6 in. east of curb stop) **BURIED** Tap reamed

Jan. 5, 1990 Top of stop box broken off 1.6 ft. below sidewalk.  
 A riser was put over box to sidewalk level.


Additional measures:

N x S line house 6.6 ft.  
 S x N line house 7.6 ft.

3/12/91: Renewed from 1' outside curb stop to prop line  
 Stock: 6ft. 3/4" copper tubing 1-3/4" curb stop  
 1- Caldwell stop box 2- 3/4x5/8 lead to cop adapt. xs.

12/18/06 Repaired service 25 ft. W x curb stop to a point 3 ft.  
 just under gas main. Stock: 3 ft. 3/4" copper tubing; 3/4" curb  
 stop; 2 - 5/8" x 3/4" lead-cop adapt. XS Bento

Nstar Gas Co. pulled service and will maintain trench.

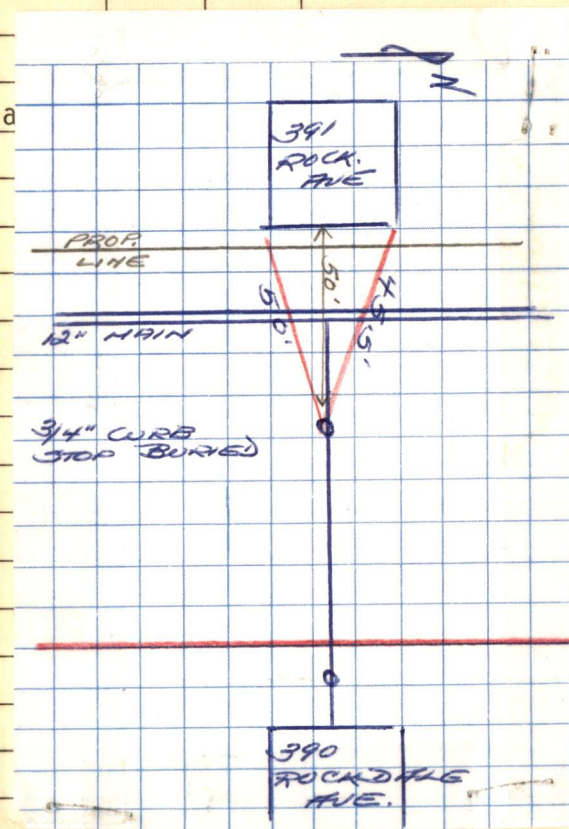

[illegible]