

APPLICATION No.: 16827

LOCATION: V 201 Nash Rd

TAP CLEARED

OWNER: _____

31-313

MEASURES: 1" Copper Service
06/11/2018 - Lead Service Replacement Program
Phase 1, Contractor P Gioioso & Son
Type CU, Diameter 1in, Water pressure 60
Distance from main to curb stop (ft) N/A
Distance from curb stop to meter (ft) 21.5
Distance from curb face to curb stop (ft) 2.0
Depth of service (ft) 3.5
Total length of new pipe installed (ft) 24.5
Curb stop replaced: no Corporation replaced: no
Ball valve replaced: yes size 1"
Remarks: 21.5 ft curb stop to house, 1.0 ft house
to meter, 3.0 ft whip

DATE

BEF.


AFT.

REMARKS

METER HISTORY

CHARGE OUTS

DATE	SET OUT	SIZE	MAKE	NUMBER	READING	TEST			REMARKS

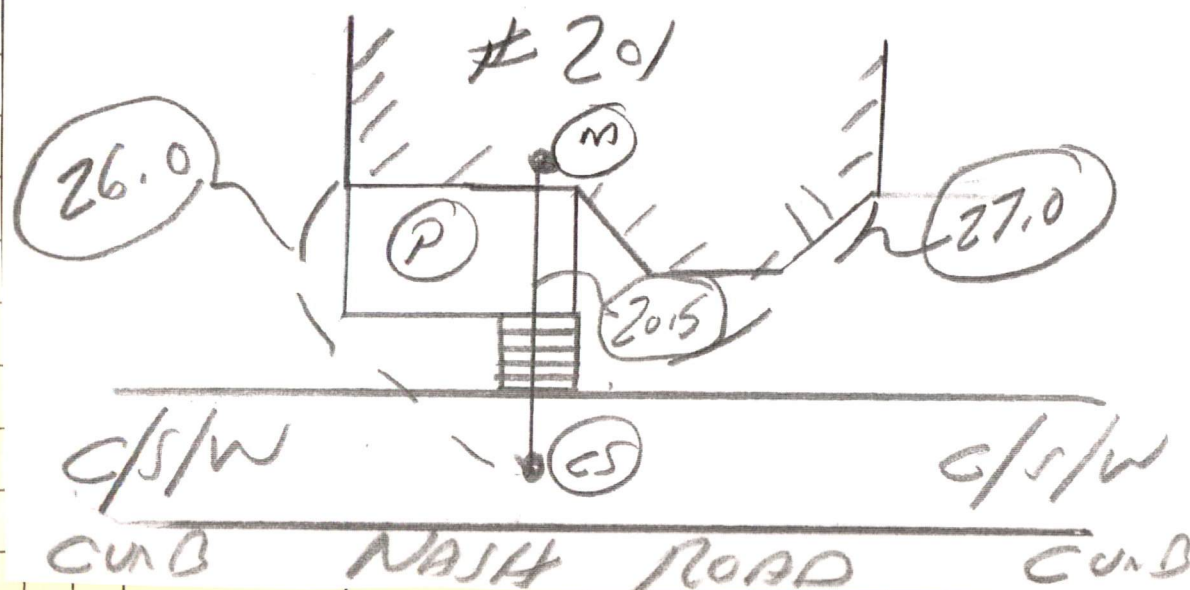

APPLICATION No.: 16827

TAP CLEARED

LOCATION: 201 Nash Rd. N.S. E. of Bowditch

DATE

BEF.

AFT.

REMARKS

OWNER: Amelia Kub

9/16/76

Reamed

MEASURES: 5/8"

E from Bowditch 263.4 ft.

S from N line Nash Rd. 9.0 ft.

E from W line House 11.1 ft.

April 29, 1975 Renewed from $\frac{1}{2}$ ft. outside curb stop to the line.

9 $\frac{1}{2}$ ft. - 3/4" Copper tubing 3/4" Curb stop
 2 - 5/8" x 3/4" lead connector Caldwell stop box

Sept. 16, 1976 Renewed from the main to a point 1 ft. from the main.

1 ft. - 3/4" Copper tubing 5/8" x 3/4" lead to
 5/8" x 3/4" Fig. 413 cop. adapt. XS

9-18-98 Renewed from main to curb stop. Stock: 34 ft. -
 3/4" Copper tubing, 1 - 5/8" x 3/4" Fig. 413. D.W. White
 to maintain trench.

[illegible]

This image shows a blank, aged, cream-colored page, likely an endpaper or flyleaf of a book. The paper has a slightly textured appearance with some minor discoloration and small dark spots, possibly due to age or handling. There is no text or other markings on the page.