

APPLICATION No.: 4698

TAP CLEARED 8818-5364

LOCATION: 91 County St.

OWNER: ✓ John Catterall

DATE

BEF.

AFT.

REMARKS

7/18/75

Reamed ✓

MEASURES: 1/2" H lead May 5, 1884

N from Division St. 88.0 ft.

E from W line County St. 4.1' 6.6 ft.

N from S line house 12.8 ft.

July 18, 1975 Renewed from the main to the property line

✓ 18 ft. - 3/4" Copper tubing Buffalo Stop Box

✓ 1 wipe joint (at line) 3/4" x 1/2" brass bushing

3/4" x 3/4" Fig. 413 3/4" curb stop

- - -

✓ 5/6/88: Reset stop box. Stock: 1-Caldwell stop box.

1" Copper Service

5/7/2019 Lead Service Line Replacement Program

Phase 1 Contractor P Gioioso &amp; Son

Type CU, Diameter (in) 1, Water Pressure 100

Distance from main to curb stop (ft) n/a

Distance from curb stop to meter (ft) 17.5

Distance from curb face to curb stop (ft) 2.5

Depth of service (ft) 4

Total length of new pipe installed (Ft) 17.5


Curb stop repalced: no, Corporation replaced: no

Ball valve furnished: yes size 1"

# METER HISTORY

## CHARGE OUTS

DATE	SET OUT	SIZE	MAKE	NUMBER	READING	TEST			REMARKS
3/21/57		5/8	Calmet	1527142					

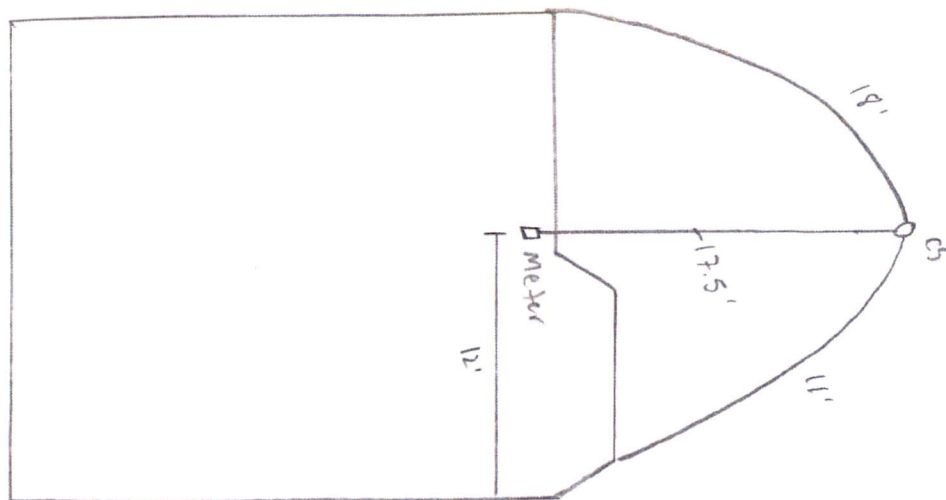



APPLICATION No.: 6058  $\frac{1}{2}$ "

## TAP CLEARED

LOCATION: 91 Rear County St.

OWNER: Frank DeMello

DATE

BEF.

AFT.

REMARKS

5/21/75

Reamed

MEASURES:  $\frac{1}{2}$ "

DEC 8, 1888

N from

Division

70.8 ft.

E from W line

County 3.5

74 ft.

N from Sline

House

16.2 ft.

May 21, 1975 Renewed from the main to the property  
line. This service had  $\frac{3}{4}$ " Copper inside property.  
Relocated stop box E x W line County St. 3.5'  
16 ft. -  $\frac{3}{4}$ " Copper tubing  $\frac{3}{4}$ " Curb Stop  
 $\frac{5}{8}$ " Fig. 413  $\frac{3}{4}$ " x  $\frac{3}{4}$ " Cplg. brass  
Caldwell Stop Box

- - -

[illegible]

## CHARGE OUTS

[illegible]