

APPLICATION No.: 7622

## TAP CLEARED

LOCATION: 37 Scott St

OWNER:

31-313

MEASURES: 1" Copper Service  
07/01/2019 Lead Service Replacement Program  
Phase 1, Contractor P Gioioso & Son  
Type CU, Diameter 1in, Water pressure 100  
Distance from main to curb stop (Ft) 28  
Distance from curb stop to meter (ft) N/A  
Distance from curb face to curb stop (ft) 1  
Depth of service (ft) 4.5  
Total length of new pipe installed (ft) 28  
Curb stop repalced: Yes size 1"  
Corporation replaced: Yes size 1"  
Ball valve replaced: No

DATE

BEF.


AFT.

REMARKS

# METER HISTORY

DATE	SET OUT	SIZE	MAKE	NUMBER	READING	TEST			REMARKS

## CHARGE OUTS

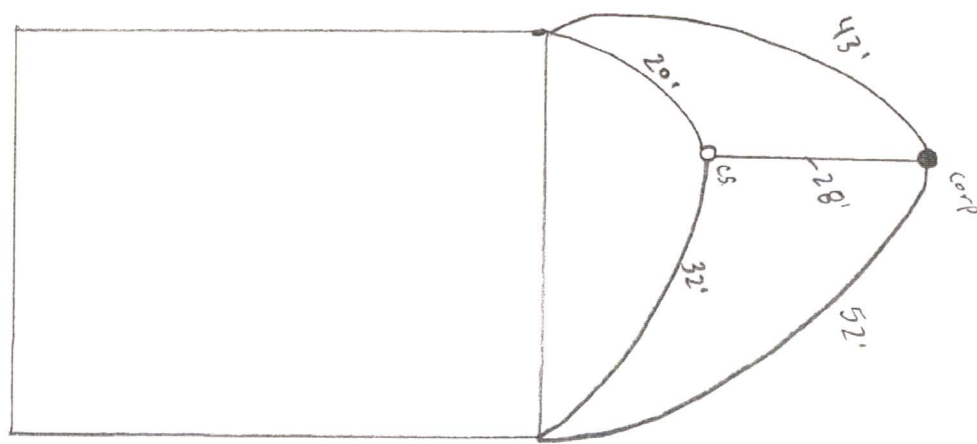

APPLICATION No.: 7622

TAP CLEARED A 2175 ✓

LOCATION: 37 Scott St.

OWNER: Maria T. Rapoza

## MEASURES:

$\frac{1}{2}$ " H lead Nov. 20, 1893  
 W from County St. 342.5 ft.  
 S from N line Scott St. 8.7 ft.  
 W from E line house 1.5 ft.

-----  
 June 7, 1956 Renewed from a point 1 ft. inside property line to inside the cellar.

8 ft. of  $\frac{3}{4}$ " copper tubing

Stock supplied and installed by owner's plumber.

-----  
 12/5/78: Renewed from 6" outside curb stop to 1 ft. inside property line. 11 ft.  $\frac{3}{4}$ " copper; 2- $\frac{5}{8}$ " x  $\frac{3}{4}$ " lead-copper adapt. XXS;  $\frac{3}{4}$ " curb stop; Caldwell stop box;

9/10/90: Renewed from main to a point 1 ft  
 Stock: 1 ft.  $\frac{3}{4}$ " copper tubing 1- $\frac{3}{4}$ x $\frac{5}{8}$  lead to cop  
 adapt. xxs 1- $\frac{3}{4}$ x $\frac{5}{8}$  Fig. 413=====

DATE

BEF.

AFT.

REMARKS

9037-0124

9/10/90: TAP REAMED



[illegible]

# CHARGE OUTS